
EMA 1710 9 Segment LCD Meter


This low cost, compact indicator is ideally suited for low or high volume applications. The meter features a 9 segment LCD to display 1V d.c. full scale reading. Other voltages and currents can be measured via the addition of 2 scaling resistors. The meter can be used in applications where the order of magnitude of the reading is more important than the value of the reading itself. It allows the operator to scan the display and receive a quick visual feedback. Installation is particularly easy; the module requires only a single round hole in the panel. A rubber seal is included, providing splashproof protection for the unit when fitted to the meter during installation.

- 9 Segment LCD
- Colour Scale
- Auto-zero
- 1V d.c. Full Scale Reading
- Single Hole Mounting
- No Calibration Required
- Splashproof

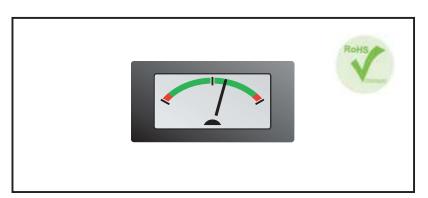

Standard Meter			S	tock Number EMA 1710
Specification	Min.	Тур.	Max.	Unit
Accuracy (overall error) *		1		Segment (<u>+</u> 1)
Full scale reading		1		V d.c.
Resolution		125		mV d.c.
Sample rate		10		samples/sec
Operating temperature range	0		50	°C
Supply voltage (V+ to V-)	5	9	12	V d.c.
Supply current (@5Vd.c.)		6		mA

^{*} At voltages above 1V d.c., the display flashes.

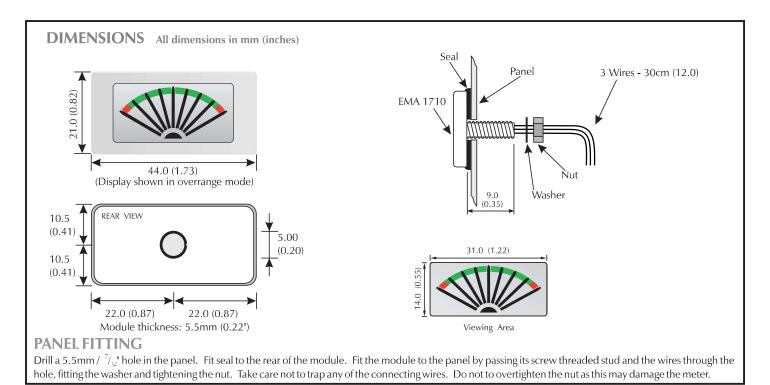



LASCAR ELECTRONICS LTD.
MODULE HOUSE, WHITEPARISH,
WILTSHIRE SP5 2SJ UK
TEL: +44 (0)1794 884567 FAX: +44 (0)1794 884616

FEL: +44 (0)1794 884567 FAX: +44 (0)1794 884616 E-mail: sales@lascar.co.uk

LASCAR ELECTRONICS INC.

4258 West 12th Street, Erie, PA 16505 USA TEL: +1 (814) 835 0621 FAX: +1 (814) 838 8141 E-mail: us-sales@lascarelectronics.com LASCAR ELECTRONICS (HK) LTD.
8th FLOOR, CHINA AEROSPACE CENTRE, 143 HOI BUN
ROAD, KWUN TONG, KOWLOON, HONG KONG
TEL: +852 2389 6502 FAX: +852 2389 6535
E-mail: saleshk@lascar.com.hk

WIRE FUNCTIONS

RED V+ Positive power supply connection. BLACK 0V Negative power supply connection.

WHITE Vin Positive measuring input with reference to 0V.


Range from 0 to 1V d.c.

SCALING

Two external resistors may be used to alter the full scale reading of the meter - see table for sample values. Alternatively, use the following formulae to calculate Ra and Rb. Select the nearest available standard resistor. To achieve optimum accuracy, use 1% metal film resistors.

Voltage Ra	
+ Vin	Ra=1M
V1 Rb V2 OV	Rb=Ra. <u>V2</u> V1-V2

Required F.S.R.	Ra	Rb
10V	910k	100k
100V	1M	10k
10mA	0R	100R
100mA	OR	10R



SAFETY

To comply with the Low Voltage Directive (LVD 93/68/EEC), input voltages to the module's pins must not exceed 60Vdc. The user must ensure that the incorporation of the unit into the user's equipment conforms to the relevant sections of BS EN 61010 (Safety Requirements for Electrical Equipment for Measuring, Control and Laboratory Use).

